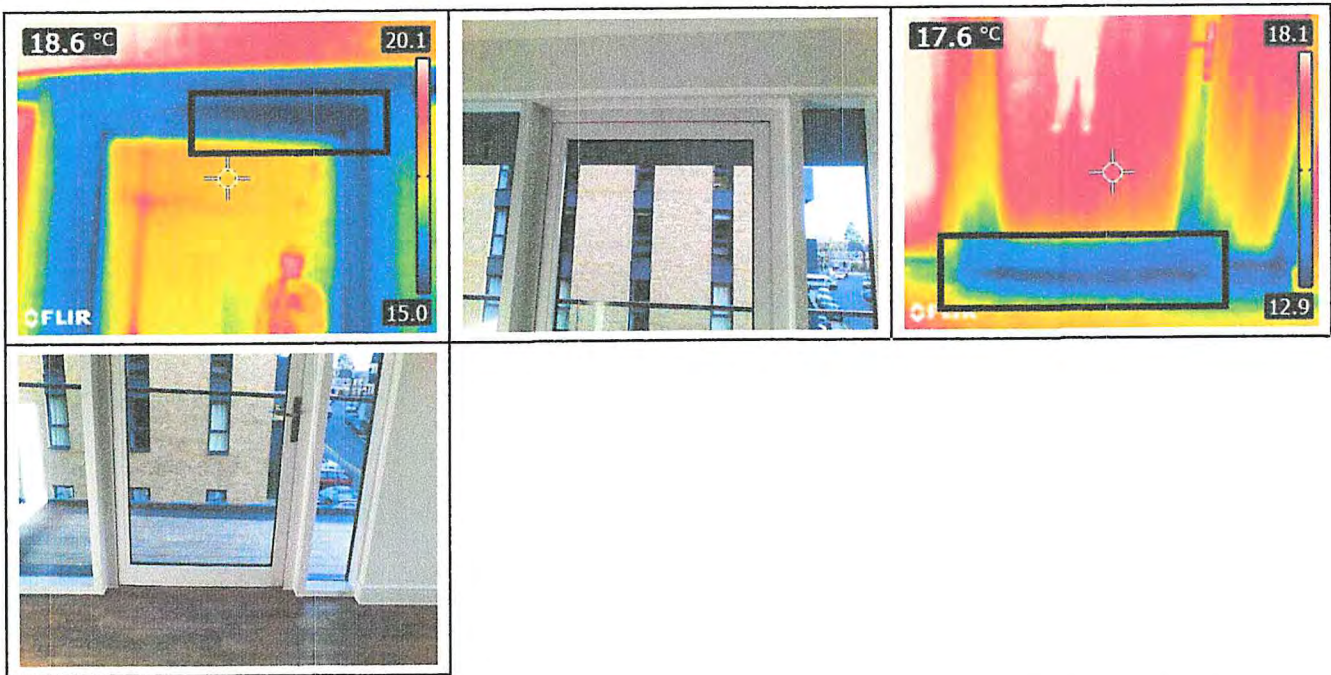
 **EXAMPLE
REPORT**

Thermographic Survey

Camera Settings

Camera	Flir e6
Internal Temperature °C	24
External Temperature °C	9
Emissivity	95.00
Reflective Temperature °C	20
Wind Direction	N/W

Balcony door



The balcony doors within the living room are showing two notable issues allowing cold air to penetrate from the external leaf. Firstly, the head of the door to the frame is showing a noticeable gap approximately 7mm wide. This gap is allowing a noticeable amount of cold air penetration due to the seal between the door and frame being incomplete. Secondly, the foot of the door along the threshold is also showing penetration, meaning the seal is inadequate between the door and threshold. This issue combined with issue 1 would suggest the door has dropped from it's hinge.



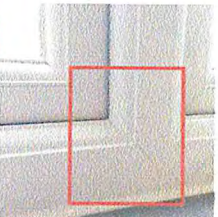

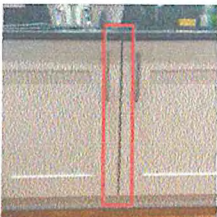
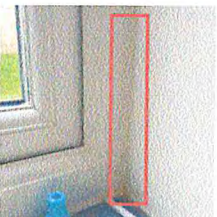
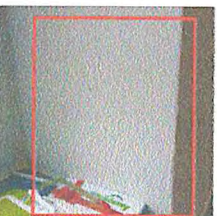
Sample Report 4

Garage

	  	<p>Unacceptable finish to pointing to elevation <input type="checkbox"/></p> <p>.....</p> <p>Inadequate dressing to tanked wall end <input type="checkbox"/></p> <p>.....</p> <p>Remediation to RWP gulley <input type="checkbox"/></p>
	 	<p>Inadequate finish to pointing to elevation <input type="checkbox"/></p> <p>.....</p> <p>Excessive gap to soffit box end - potential infestation (check opposite side) <input type="checkbox"/></p>
	 	<p>Pattress for electrical components to right elevation not secured correctly <input type="checkbox"/></p> <p>.....</p> <p>Pattress for electrical components to rear elevation not secured correctly <input type="checkbox"/></p>

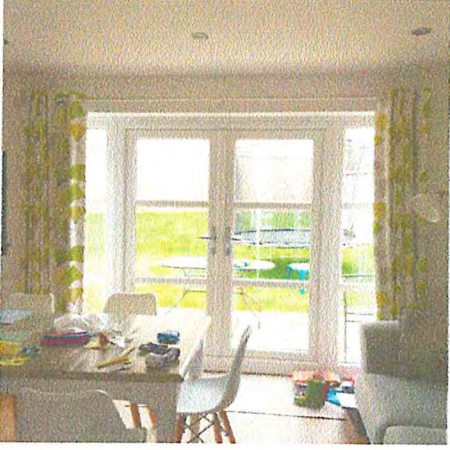
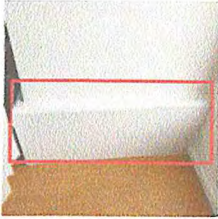



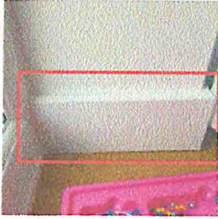
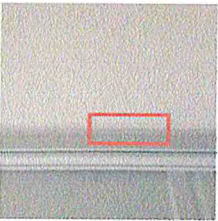
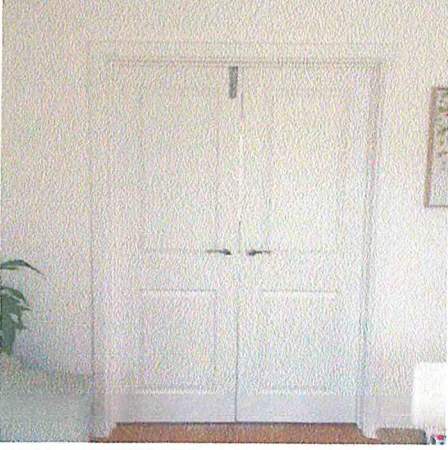
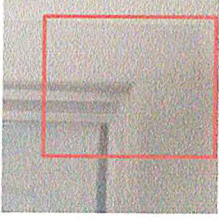
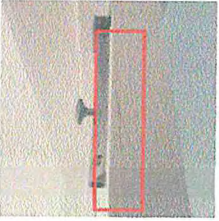
Sample Report 4

Kitchen





		<p>Inconsistent finish to decoration to window reveals</p>	<input type="checkbox"/>
		<p>Slight damage to glazing bead to centre fixed unit</p>	<input type="checkbox"/>
		<p>General marks and residue to window frame perimeters</p>	<input type="checkbox"/>
		<p>Sink base unit doors misaligned</p>	<input type="checkbox"/>
		<p>Inconsistent finish to mastic seal to window frame perimeters</p>	<input type="checkbox"/>
		<p>Inconsistent finish to decoration to window reveals</p>	<input type="checkbox"/>

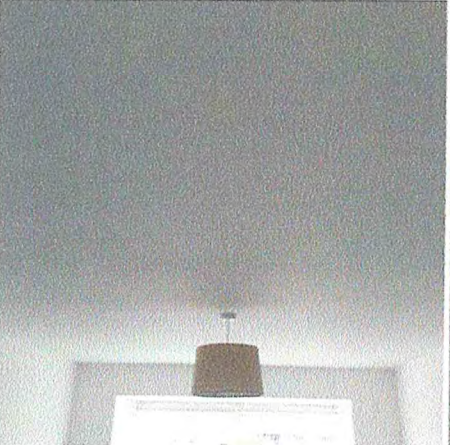

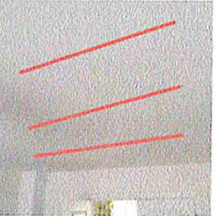
Sample Report 4

Dining Room

		<p>Inadequate finish to decoration to RH skirting return</p>	<input type="checkbox"/>
		
		<p>Both French doors binding on bottom keep</p>	<input type="checkbox"/>
.....			
		<p>French doorset handles loose</p>	<input type="checkbox"/>
		<p>Inadequate finish to decoration to RH skirting return</p>	<input type="checkbox"/>
		
		<p>Inconsistent finish to mastic seal above LH trickle vent</p>	<input type="checkbox"/>
		<p>Inconsistent finish to decoration to RH architrave mitre</p>	<input type="checkbox"/>
		
		<p>Noted: minor split to top of slave door edge</p>	<input type="checkbox"/>

Sample Report 4
Lounge

		Door not latching correctly	<input type="checkbox"/>
	<hr/>		
		Door latch not operating correctly	<input type="checkbox"/>
<hr/>			
		Slight damage to top of door edge	<input type="checkbox"/>

		Board joints visible to ceiling area and generally uneven	<input type="checkbox"/>
	<hr/>		
		Board joints visible to ceiling area and generally uneven	<input type="checkbox"/>